

# GENERAL ELECTRIC

OUTDOOR  
POWER EQUIPMENT  
OPERATION

GENERAL ELECTRIC COMPANY, CORPORATIONS PARK, BUILDING 702,  
SCHENECTADY, NEW YORK 12345, Phone (518) 374-2211

March 12, 1974

TO: ELEC-TRAK TRACTOR DEALERS

SUBJECT: ER8-36 SEAT REMOUNTING

A few of the ER8-36 Rider Mowers must have the rubber bumpers normally found underneath the seat removed so the seat switch will function safely. Simply, if the bumpers remain under the seat, the seat will not depress far enough to engage the switch.

This situation occurs in ER8-36 Rider Mowers with serial numbers from 472 through 586, but there are exceptions. The exceptions have the following serial numbers:


491	505	515	524	556
492	506	521	529	557
493	513	522	548	562
494	514	523	555	577

All units with serial numbers prior to 472 should have the rubber bumpers installed.

All units with serial numbers 587 or later should not have the bumpers.

If you have any questions, please don't hesitate to contact us.

Sincerely,

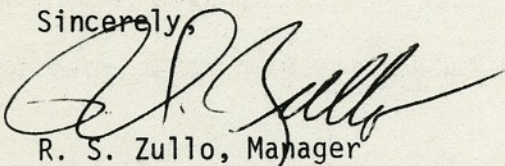

R. S. Zullo, Manager  
Sales & Service Consulting

RSZ/1ba

CC: Elec-Trak Tractor Sales Representatives

